

### NPEXA-C211 etc.


 O The following table shows the values of the current output during a overrange alarm mode, take 4~20mA output as an example. Default following mode.

Alarm mode	Breakage	Downscale	Upscale	Short- circuit
Following mode	0mA	0~4mA	20~22mA	0mA
4~20mA NE43	2mA	3.8~4mA	20~20.5mA	21.5mA
Alarm value output mode (e.g. 3.5mA)				

 ${\bf O}\,$  DIN rail power supply function is selectable at ordering.

### Dimension

Width × Height × Depth: 12.8 mm × 110 mm × 117 mm

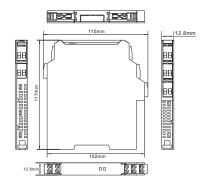

## ➔ Introductions

This isolated safety barrier converts the thermal resistance signals from a hazardous area into current or voltage signals to a safe area. DIN rail power supply function can be selected in ordering.

The input, output, and power supply are galvanically isolated from each other. Calibrate the apparatus or modify parameters by using a handheld programmer.

#### → Parameters

Explosive-proof grade: [Ex ia Ga] IIC; [Ex ia Da] IIIC

### Power supply:

Connection type: Terminals (9+, 10-) or DIN rail connector Rated voltage: 18V DC ~ 60V DC (Recommended: 24V DC) Input (1, 2, 3): 2/3-wire RTD

The input signal needs to be determined when ordering and can also be programmed. Other signal types is required special customization, please see the productlabel for details.

Line resistance:  $\leq 20 \ \Omega$  per line

#### Output (5, 6; 7, 8):

Output current: 0(4) ~ 20 mA; 0 ~ 10 mA; 20 ~ 4 mA Output voltage: 0(1) ~ 5 V; 0 ~ 10 V

Note: 4~20mA Outputs can be configured NAMUR NE 43.

**Output ripple:**  $\leq 5 \text{ mV}_{\text{rms}}$  (Load resistance: 250  $\Omega$ )

#### Load resistance:

 $0(4) \sim 20 \text{ mA}, 20 \sim 4 \text{ mA}: \le 550 \Omega; 0 \sim 10 \text{ mA}: \le 1.1 \text{ k}\Omega$ 

 $0(1) \sim 5 \forall \geq 1 M\Omega; 0 \sim 10 \forall \geq 2 M\Omega$ 

Other load resistance is required special customization,

please see the productlabel for details.

#### Transmission characteristics (25 °C ± 2 °C):

Standard	Input	Range/Accuracy		
IEC 60751	Pt100 (α=0.00385)	<100°C, ±0.1°C; ≥100°C, ±0.1%F.S.		
	Pt100 (α=0.00391)	<100°C, ±0.1°C; ≥100°C, ±0.1%F.S.		
	Cu50 (a=0.00428)	<100°C, ±0.1°C; ≥100°C, ±0.1%F.S.		
	Cu100 (a=0.00428)	<100°C, ±0.1°C; ≥100°C, ±0.1%F.S.		
	Cu50 (a=0.00426)	<100°C, ±0.1°C; ≥100°C, ±0.1%F.S.		
	Cu100 (a=0.00426)	<100°C, ±0.1°C; ≥100°C, ±0.1%F.S.		

Response time: ≤ 0.5 s

Temperature drift: 30 ppm/°C

Electromagnetic compatibility: Accordance to IEC 61326-3-1

Dielectric strength (1 mA leakage current, 1 minute test time):

≥ 3000 V AC (Intrinsically safe side / Non-intrinsically safe side)



Insulation resistance: ≥ 100 MΩ (Input /Output/Power supply) Parameters certified by National Supervision and Inspection Center for Explosion Protection and Safety of Instrumentation (NEPSI):

Um: 250 V

Terminals 1, 2, 3:

U<sub>o</sub>: 8.7 V I<sub>o</sub>: 33 mA P<sub>o</sub>: 72 mW

IIC: Co: 5µF; Lo: 28mH

IIIC(IIB): Co: 49µF; Lo: 84mH

#### Ambient conditions:

Operation temperature: −20 °C ~ +60 °C Relative humidity: 10 %RH ~ 90 %RH (40 °C)

Atmosphere pressure: 80 kPa ~ 106 kPa


Storage temperature: -40 °C ~ +80 °C

#### Power dissipation:

0.8 W (24 V DC, single output)

1.2 W (24 V DC, double output)

→ Wiring diagram

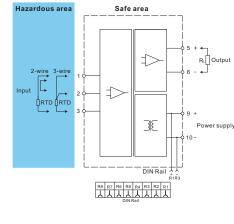

NPEXA-C21 etc.

Nanjing New Power Electric Technology Co., Ltd.

C Series Single Channel


**RTD** Isolated Safety Barrier

# **NewPwr**®

#### → Applications

This apparatus is used for transmitting signals between field devices and process control system. It can be used to connect field equipment which is installed in potentially explosive gas environment, and protect the intrinsically safe equipment in a hazardous area by limiting current and limiting voltage.

The apparatus can convert the thermal resistance signals into current or voltage signals, and then transmit the output signal to the connected process control system.




#### → BUS Specification


BUS	<b>Electrical Characteristics</b>
Current	Max. 8 A
Voltage (UL/IEC)	1.6 kV
Operation temperature	−40 °C ~ +105 °C

#### → Installation


- O The apparatus can be installed on the DIN 35 mm standard rail which is corresponding to DIN IEC 60715.
  The must be snapped onto the rail, and never slanted or tipped to the side.
- O Installation and disassembly steps are shown in following figures:




A. Snap the BUS socket on the DIN 35 rail, as figure A;

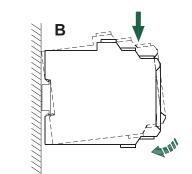

B. Snap lock onto mounting rail, then rotate the device, as figure B, press down the device onto mounting rail, make sure that the BUS connector pins of device and BUS socket are in close contact.

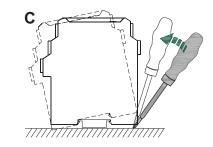


C. Pry the lock off the rail with screwdriver as arrow shown, pull downward the lock, and rotate the device.

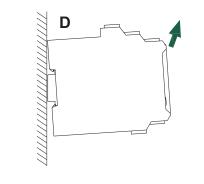


D. Remove the device as arrow shows.

O Low heat dissipation allows vertical or horizontal mounting without spacing. Normal operation is guaranteed over the full temperature range of the system in any mounting direction and without restriction.

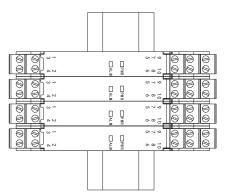

Vertically installation

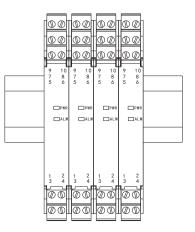

Horizontally installation

#### → Light indication

**PWR**: Power indicator light shows green, it means work normally.

O ALM: Input signal state indicator (red), it is off during normal operation, remain bright when input over-range; It is glitter when input line breakage or short circuit (except for linear resistance short circuit).

#### → Attention

 Isolated Safety Barriers degree of protection is IP 20 and must be protected from undesirable ambient conditions (waterproofing, small foreign objects). It is suitable for installation in the control room or high density field cabinet, DIN 35 mm installation is convenient for installation and displacement.

- O The devices were designed for use in pollution degree 2 and overvoltage category III as per IEC/EN 60664-1. If used in areas with higher pollution degree, the devices need to be protected accordingly.
- O Installation position shall not be affected by strong mechanical vibration; impact and electromagnetic induction from signal terminal and power supply, should conformity with the requirements on electromagnetic interference resistance of products in Class 3 industrial field atmosphere stipulated in IEC 61000-4; the atmosphere shall be free from gases that are corrosive to metal and plastic components.
- O The apparatus may only be operated, maintained and decommissioned by competent according with the instruction manual, and it must be installed, connected and adjusted in non-hazardous area.
- O The operator must strictly comply with the relevant local safety standards and guidelines.

#### → Supplementary instructions

O Our company reserves the right to change the product information without prior notification to the user. If the contents of the description are different from website or sample, this description shall prevail.